

# DIGITAL MULTIMETERS

MEASURES VOLTAGE, AMPERAGE, RESISTANCE AND CONTINUITY

- Four new Multimeters
- cULus Listed
- CAT IV 600V, CAT III 1000V for 1000V models
- CAT III 600V for 600V models
- Backlit displays
- IP52 Ingress protection (61-357 & 61-347)
- 2M drop protection (61-357 & 61-347); 1M drop protection (61-337 & 61-327)
- Lead Warning and Fuse Notification (61-357, 61-347 & 61-337)



**61-357**

1000V Auto Range TRMS  
6000 Count Display Multimeter w/  
NCVT, Temp, Bar Graph & LoZ  
CAT IV 600V | CAT III 1000V



**61-347**

1000V Auto Range TRMS  
6000 Count Display  
Multimeter w/NCVT, & Temp  
CAT IV 600V | CAT III 1000V





**61-337**

600V Auto Range  
Multimeter w/NCVT & Temp  
CAT III 600V



**61-327**

600V Manual Range  
Multimeter w/ NCVT CAT III 600V

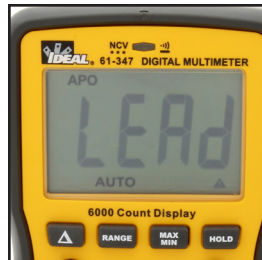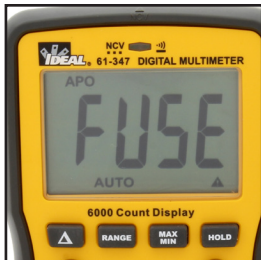

# ACCESSORIES



**TC-757**  
Thermocouple



**TL-757**  
Test Leads w/Alligator Clips  
For Use with: 61-357, 61-347, 61-337, 61-327




**UMHS-757**  
Universal Magnetic Hanging Strap  
For Use with: 61-357, 61-347, 61-337, 61-327




**C-357**  
Nylon Carrying Case  
For Use with: 61-357, 61-347, 61-337, 61-327



**F-11A-347357**  
Fuse for 61-357 & 61-347



**F-600mA-347357**  
Fuse for 61-357 & 61-347



**F-10A-337**  
Fuse for 61-337





**F-400mA-337**  
Fuse for 61-337



Scan this QR code with your smartphone to learn more about the testers.

# DIGITAL MULTIMETERS

MEASURES VOLTAGE, AMPERAGE, RESISTANCE

DIGITAL MULTIMETER SELECTION GUIDE FOUR NEW MULTIMETERS	 NEW	 NEW	 NEW	 NEW
	61-357	61-347	61-337	61-327
<b>FEATURES</b>				
CAT Rating (Safety)	CAT IV 600V   CAT III 1000V	CAT IV 600V   CAT III 1000V	CAT III 600V	CAT III 600V
Listing	cULus, CE, RCM	cULus, CE, RCM	cULus, CE, RCM	cULus, CE, RCM
Drop Protection	6.6 ft. (2m)	6.6 ft. (2m)	3.3 ft. (1m)	3.3 ft. (1m)
Ingress Protection	IP52	IP52	—	—
AC Voltage (Volts)	1000V	1000V	600V	600V
DC Voltage (Volts)	1000V	1000V	600V	600V
AC Current (Amps)	10A	10A	10A	—
DC Current (Amps)	10A	10A	10A	—
Ohms (Resistance)	60MΩ	60MΩ	40MΩ	4MΩ
AC Millivolts	6000	6000	4000	—
DC Millivolts	6000	6000	4000	4000
AC Milliamps	6000	6000	4000	—
DC Milliamps	6000	6000	4000	—
AC Microamps	6000	6000	4000	—
DC Microamps	6000	6000	4000	—
True RMS	✓	✓	—	—
High Voltage Alarm	ACV/DCV   >30V	ACV/DCV   >30V	ACV/DCV   >30V	ACV/DCV   >30V
Audible Continuity	✓	✓	✓	✓
Visual Continuity	✓	✓	✓	✓
Backlight	✓	✓	✓	✓
Temperature	-40 ~ 1832°F   -40 ~ 1000°C	-40 ~ 1832°F   -40 ~ 1000°C	-40 ~ 1832°F   -40 ~ 1000°C	—
Low Impedance (LoZ)	✓	—	—	—
NCV	✓	✓	✓	—
Auto Ranging	✓	✓	✓	—
Range Hold	✓	✓	✓	—
Data Hold	✓	✓	✓	✓
Diode Test	✓	✓	✓	✓
Capacitance Test	6000 μF	6000 μF	4000 μF	—
Frequency / Duty Cycle	10Hz - 9.99 KHz	10Hz - 9.99 KHz	10Hz - 9.99 KHz	10Hz - 9.99 KHz
Max / Min	✓	✓	✓	—
Magnetic Strap Mount	✓	✓	✓	✓
Test Probe Holder	✓	✓	✓	✓
Auto-Power Off	✓	✓	✓	✓
APO Disable	✓	✓	✓	✓
Low Battery Indication	✓	✓	✓	✓
Battery Type (Included)	3 x 1.5V AAA	3 x 1.5V AAA	3 x 1.5V AAA	3 x 1.5V AAA
LCD Display Count	6000	6000	4000	2000
Lead Warning	✓	✓	✓	—
Fuse Notification	✓	✓	✓	—
Bar Graph	✓	—	—	—
Battery Test	—	—	—	✓
Warranty	2-Year*	2-Year*	2-Year*	2-Year*
<b>Accessories</b>				
Leads, Case & Temp. Sensor	Included	Included	Included	Leads Only



IDEAL INDUSTRIES, INC.

IDEAL INDUSTRIES, INC.  
1800 S. Prairie Drive, Sycamore, IL 60178, USA / 815-895-5181 • 800-435-0705 in USA

International offices:  
Australia • Canada • China • France • India • Germany • Mexico • UK

For complete sales office contact information, visit us at:

[www.idealind.com](http://www.idealind.com)